

CT90K5

COMPARISON OF CT90K5 TO CT90K4

1. ENGINE STOP SWITCH

A new engine stop switch was added to the headlight switch housing at the right side of the handlebar.

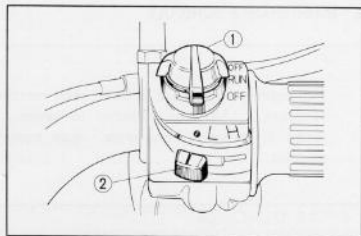


Fig. K5.1 ① Engine stop switch ② Headlight switch

2. BRAKE WEAR INDICATOR

On the CT90K5, new wear indicators were provided in the front and rear brakes. When the brake applied, an arrow, adjacent to the brake arm, moves toward a reference mark on the brake panel. The distance between the arrow and the reference mark, on full application of the brake, indicates brake lining thickness.

3. REAR BRAKE

The rear lever brake at the left side of the handlebar, hitherto offered, was discontinued.

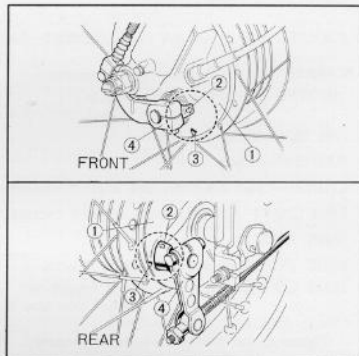


Fig. K5.1 ① Brake panel ② Arrow
③ Reference mark ④ Brake