




### HANDLEBAR SWITCHES

The handlebar cluster switches (light, turn signals, horn, engine stop, starter) must be replaced as an assembly.

Continuity tests for the components of the handlebar cluster switches follow:

Remove the headlight.

Continuity should exist between the color coded wires on each chart.

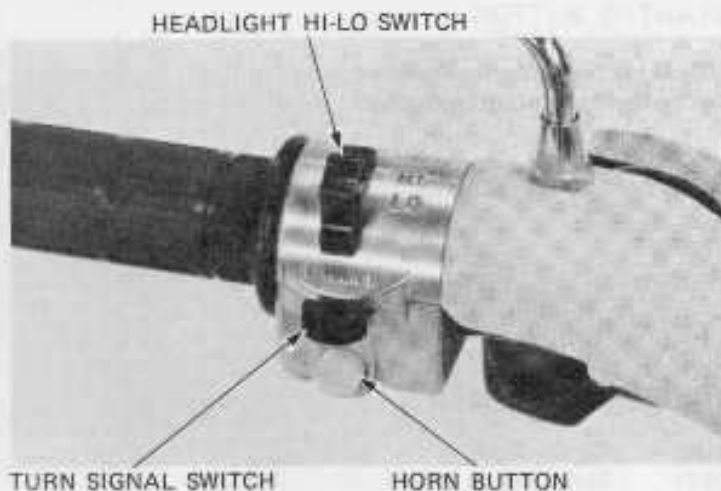

### HEADLIGHT HI-LOW SWITCH

HI: B to Y  
MIDDLE (N): Y to B to W  
LO: Y to W

Headlight Hi-Low Switch

	Hi	Cl	Lo
Hi	○	○	
(N)	○	○	○
Lo		○	○
Color code	B	Y	W

### TURN SIGNAL SWITCH

LEFT: O to Gr  
OFF: No continuity  
RIGHT: LB to Gr

Turn Signal Switch

	R	W	L
LEFT		○	○
OFF			
RIGHT	○	○	
Color code	LB	Gr	O

### HORN BUTTON

LG to G with button depressed.  
No continuity with button released.

Horn Button

	Ho	E
Color Code	LG	G